

52

Date: Monday, 12/17/2007 1:09:25 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206L AFT X-TUBE
 Job Number : 36381
 Estimate Number : 10973
 P.O. Number :
 This Issue : 12/17/2007 S.O. No. :
 Prsht Rev. : NC
 First Issue : / / Type : LANDING GEAR
 Previous Run : 36380
 Written By :
 Checked & Approved By :
 Comment : Est Rev: F 05.09.01 Add holes for compatibility with Bell
 Skidtubes KJ/JLM

Part Number : D206667203
 Drawing Number : D206-667-243 REVB
 Project Number : N/A
 Drawing Revision : B
 Material :
 Due Date : 12/24/2007 Qty: 1 Um: Each

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description:

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D206-667-203 CHG002

08/01/08 07.12.19

2.0 D6004115 Crosstube material



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6004-115

Crosstube

B 32305

Check OD = 2.500"; ID = 1.800"

20 08/01/03

3.0 MORI SEIKI MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA089

2-Turn first side as per Folio FA089

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-243.

J.F. 08/01/08

(1)

4.0 QC1 INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

J.F. 08/01/08

(1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/17/2007 1:09:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L AFT X-TUBE

Job Number: 36381

Part Number: D206667203

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA089

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-243.

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-243

Inside of Cuff(Donot engrave on outside of tube)

J.F. 08/01/08

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

J.F. 08/01/08

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

J.F. 08/01/08 (1)

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Polish entire outside surface of crosstube

AWM 08-01-14

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DD 8-1-14

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

AWM 08-01-14

11.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D206-667-243 using CNC bender program 206L-AF and Folio FT_____

EL 8-1-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/11/2007 1:09:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L AFT X-TUBE

Job Number: 36381

Part Number: D206667203

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

08-01-15 (D)

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 as per Dwg D206-667-243. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-243
Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8583 & DT8584 as per Dwg D206-667-243. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-243

6-Drill Fwd rivet holes using drill Jig DT8789FWD as per Dwg D206-667-143. Note: Fwd side has 3x top holes.

7-Drill Aft rivet holes using drill Jig DT8789 as per Dwg D206-667-243.

8-C'sink holes as per Dwg D206-667-243.

9-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-243

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

AWM 08-01-16

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-01-16 (X)

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08-01-16 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/17/2007 1:09:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L AFT X-TUBE

Job Number: 36381

Part Number: D206667203

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

OUTSIDE SERV.10

OUTSIDE SERVICES -LG



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038Or

Issue P/O: 5502

C208/01/210

LPI as per ASTM 1417

Level 2 Attach copy of NDT results to work order

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage

Ensure copy of NDT results attached to work order.

C208/01/210

19.0

QC6

DIMENSIONAL CHECK



Comment: Inspect for damage & ensure results are as per Dwg D206-667-103

C 006/01/210

20.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Mask Threaded holes

2-Prime inside and outside crosstube as per QSI 005 4.2

3-Paint outside crosstube with White Imron as per QSI 005 4.2

RT 08-02-04

21.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Wrap in plastic bag to protect from scratches

RT 08/02/05 (1)

22.0

D2873045

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-045 Nut Plate 34077

RT 08 02 01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/17/2007 1:09:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L AFT X-TUBE

Job Number: 36381

Part Number: D206667203

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

D2873043

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-043

Nut Plate

36064

RT 08-02-01

24.0

MS20601AD4W10

RIVET



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part number Description Batch

14 MS20601AD4W10 Rivet

105057

RT 08-02-01

25.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install nut plates as per Dwg D206-667-243.

RT 08-02-01

26.0

D2856400

Abrasion Strip



Comment: Qty.: 1.3525 f(s)/Unit Total : 1.3525 f(s)

Pick:

Qty Part number Description Batch

2 D2856-400(Cut to 7.73") Abrasion Strip

35900

RT 08-02-06

27.0

D28921

Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2892-1

Support

34063

RT 08-02-06

28.0

MS2192022

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-22

Clamp

101792

RT 08-02-06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/17/2007 1:09:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L AFT X-TUBE

Job Number: 36381

Part Number: D206667203

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8580. Note: (3) top holes should be facing up.

2-Install supports and clamps as per Dwg D206-667-243. Torque clamps to 80-100 in lb

PT 08-02-06

30.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/02/06 (4)

31.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

32.0

AN534A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Bolt

Batch: M1-5408

PC

33.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Nut

Batch: M1-5940

PC

34.0

AN510A

Bolt



Comment: Qty.: 10.0000 Each(s)/Unit Total: 10.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

10 AN5-10A

Bolt

M1-4746

PC

35.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

M1-5408

PC 8/26 ①

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 12/17/2007 1:09:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L AFT X-TUBE

Job Number: 36381

Part Number: D206667203

Job Number:



Seq. #:

Machine Or Operation:

Description :

4 AN5-32A

Bolt

36.0

AN960JD516

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick: Packing Kit

Qty Part number Description Batch

18 AN960JD516 Washer *M/26167*

37.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

38.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-667-203

Location: *C*

PPP Rev: *C*

39.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08.02.13

Job Completion



mi 2008/2/11



W

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	36381
Description: Crosstube Assembly		Part Number:	D206-667-243
Inspection Dwg: D206-667-243 Rev: B		Page 1 of 1	

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype


Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.495"	✓		
	2.018	+0.005/-0.000	2.023"	✓		
	2.079	+0.005/-0.000	2.084"	✓		
	2.145	+0.005/-0.000	2.149"	✓		
	2.209	+0.005/-0.000	2.213"	✓		
	2.287	+0.005/-0.000	2.291"	✓		
	2.363	+0.005/-0.000	2.365"	✓		
	2.433	+0.005/-0.000	2.437"	✓		
	0.200	+/-0.010	.200"	✓		
	0.500 x 30°	+/-0.010	.500 x 30°	✓		
	R0.063	+/-0.010	R0.063"	✓		
	R0.500	+/-0.010	R0.500"	✓		
	4.438	+/-0.030	4.425"	✓		
SIDE B	104.91	+/-0.020	104.910"	✓		
	2.490	+0.005/-0.000	2.493"	✓		
	2.018	+0.005/-0.000	2.023"	✓		
	2.079	+0.005/-0.000	2.084"	✓		
	2.145	+0.005/-0.000	2.150"	✓		
	2.209	+0.005/-0.000	2.214"	✓		
	2.287	+0.005/-0.000	2.290"	✓		
	2.363	+0.005/-0.000	2.364"	✓		
	2.433	+0.005/-0.000	2.436"	✓		
	0.200	+/-0.010	.200"	✓		
	0.500 x 30°	+/-0.010	.500 x 30°	✓		
	R0.063	+/-0.010	R0.063"	✓		
	R0.500	+/-0.010	R0.500"	✓		
	4.438	+/-0.030	4.437"	✓		

Measured by: J.F.	Audited by: J.F.	Prototype Approval:	N/A
Date: 08/01/08	Date: 08/01/08	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	06.09.01	New Issue (P/O D206-667-203)	KJ/JLM	

DART AEROSPACE LTD		Work Order:	36381
Description: Crosstube High Aft (206L)		Part Number:	D206-667-203
Inspection Dwg: D206-667-243 Rev: B		Page 1 of 1	

Required Dimension	Min	Max
Height	23.46	23.58
1/2 Span	41.86	41.98
Angle	54	56
Total Span	83.72	83.96

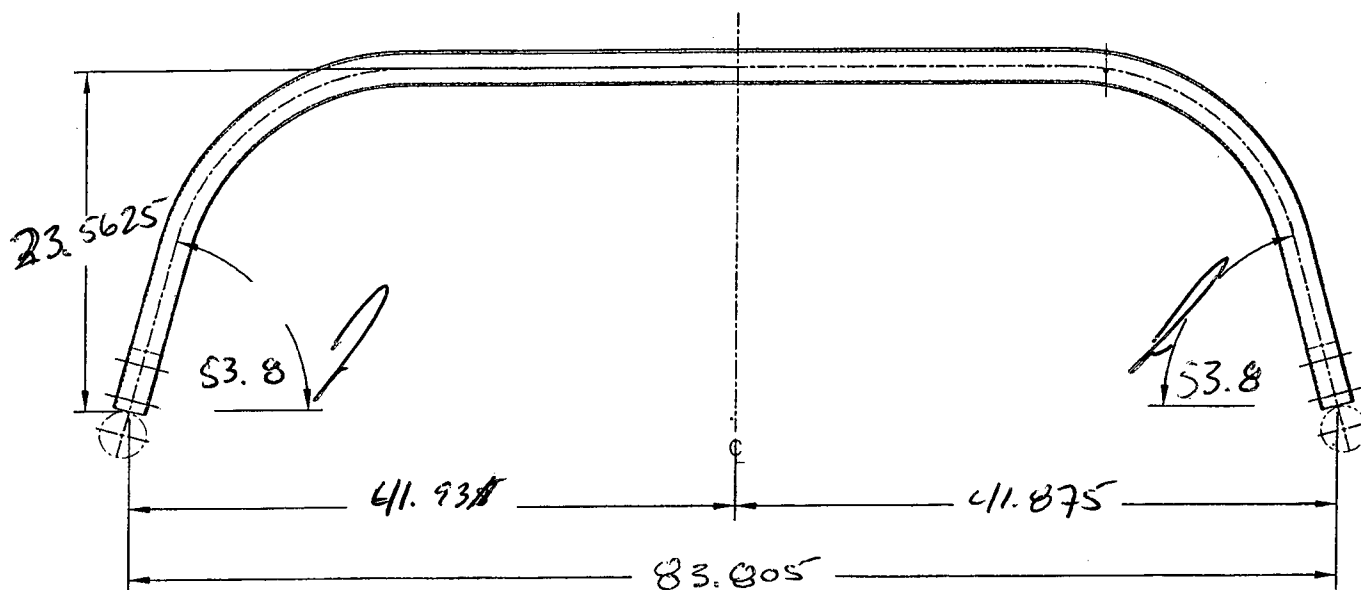

Comments

QC15 Inspection	<i>[Signature]</i> 06.01.15
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM <i>[Signature]</i>	<i>[Signature]</i>

DART

DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED # DS	APPROVED # DS	DRAWING NO. D206-667-243	REV. B SHEET 1 OF 3
DATE 05.07.26		TITLE CROSSTUBE ASS'Y (206L HIGH AFT) NTS	
A	00.11.17	NEW ISSUE	
B	05.07.26	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

RELEASED
05.07.26 #**UNDER REVIEW**

06.07.10 RH

12 draw detail F

RH


07.05.02

Qty	Part Number	Description
X	D206-667-243	CROSSTUBE ASSEMBLY
1	D6004-115	CROSSTUBE
2	D2856-400-773	ABRASION STRIP
2	D2873-043	NUT PLATE
2	D2873-045	NUT PLATE
2	D2892-1	SUPPORT
14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
4	MS21920-22	CLAMP

GENERAL NOTES:


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6004-115
FINISHED LENGTH = 104.91±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2892-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKAFLEX-241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 36381

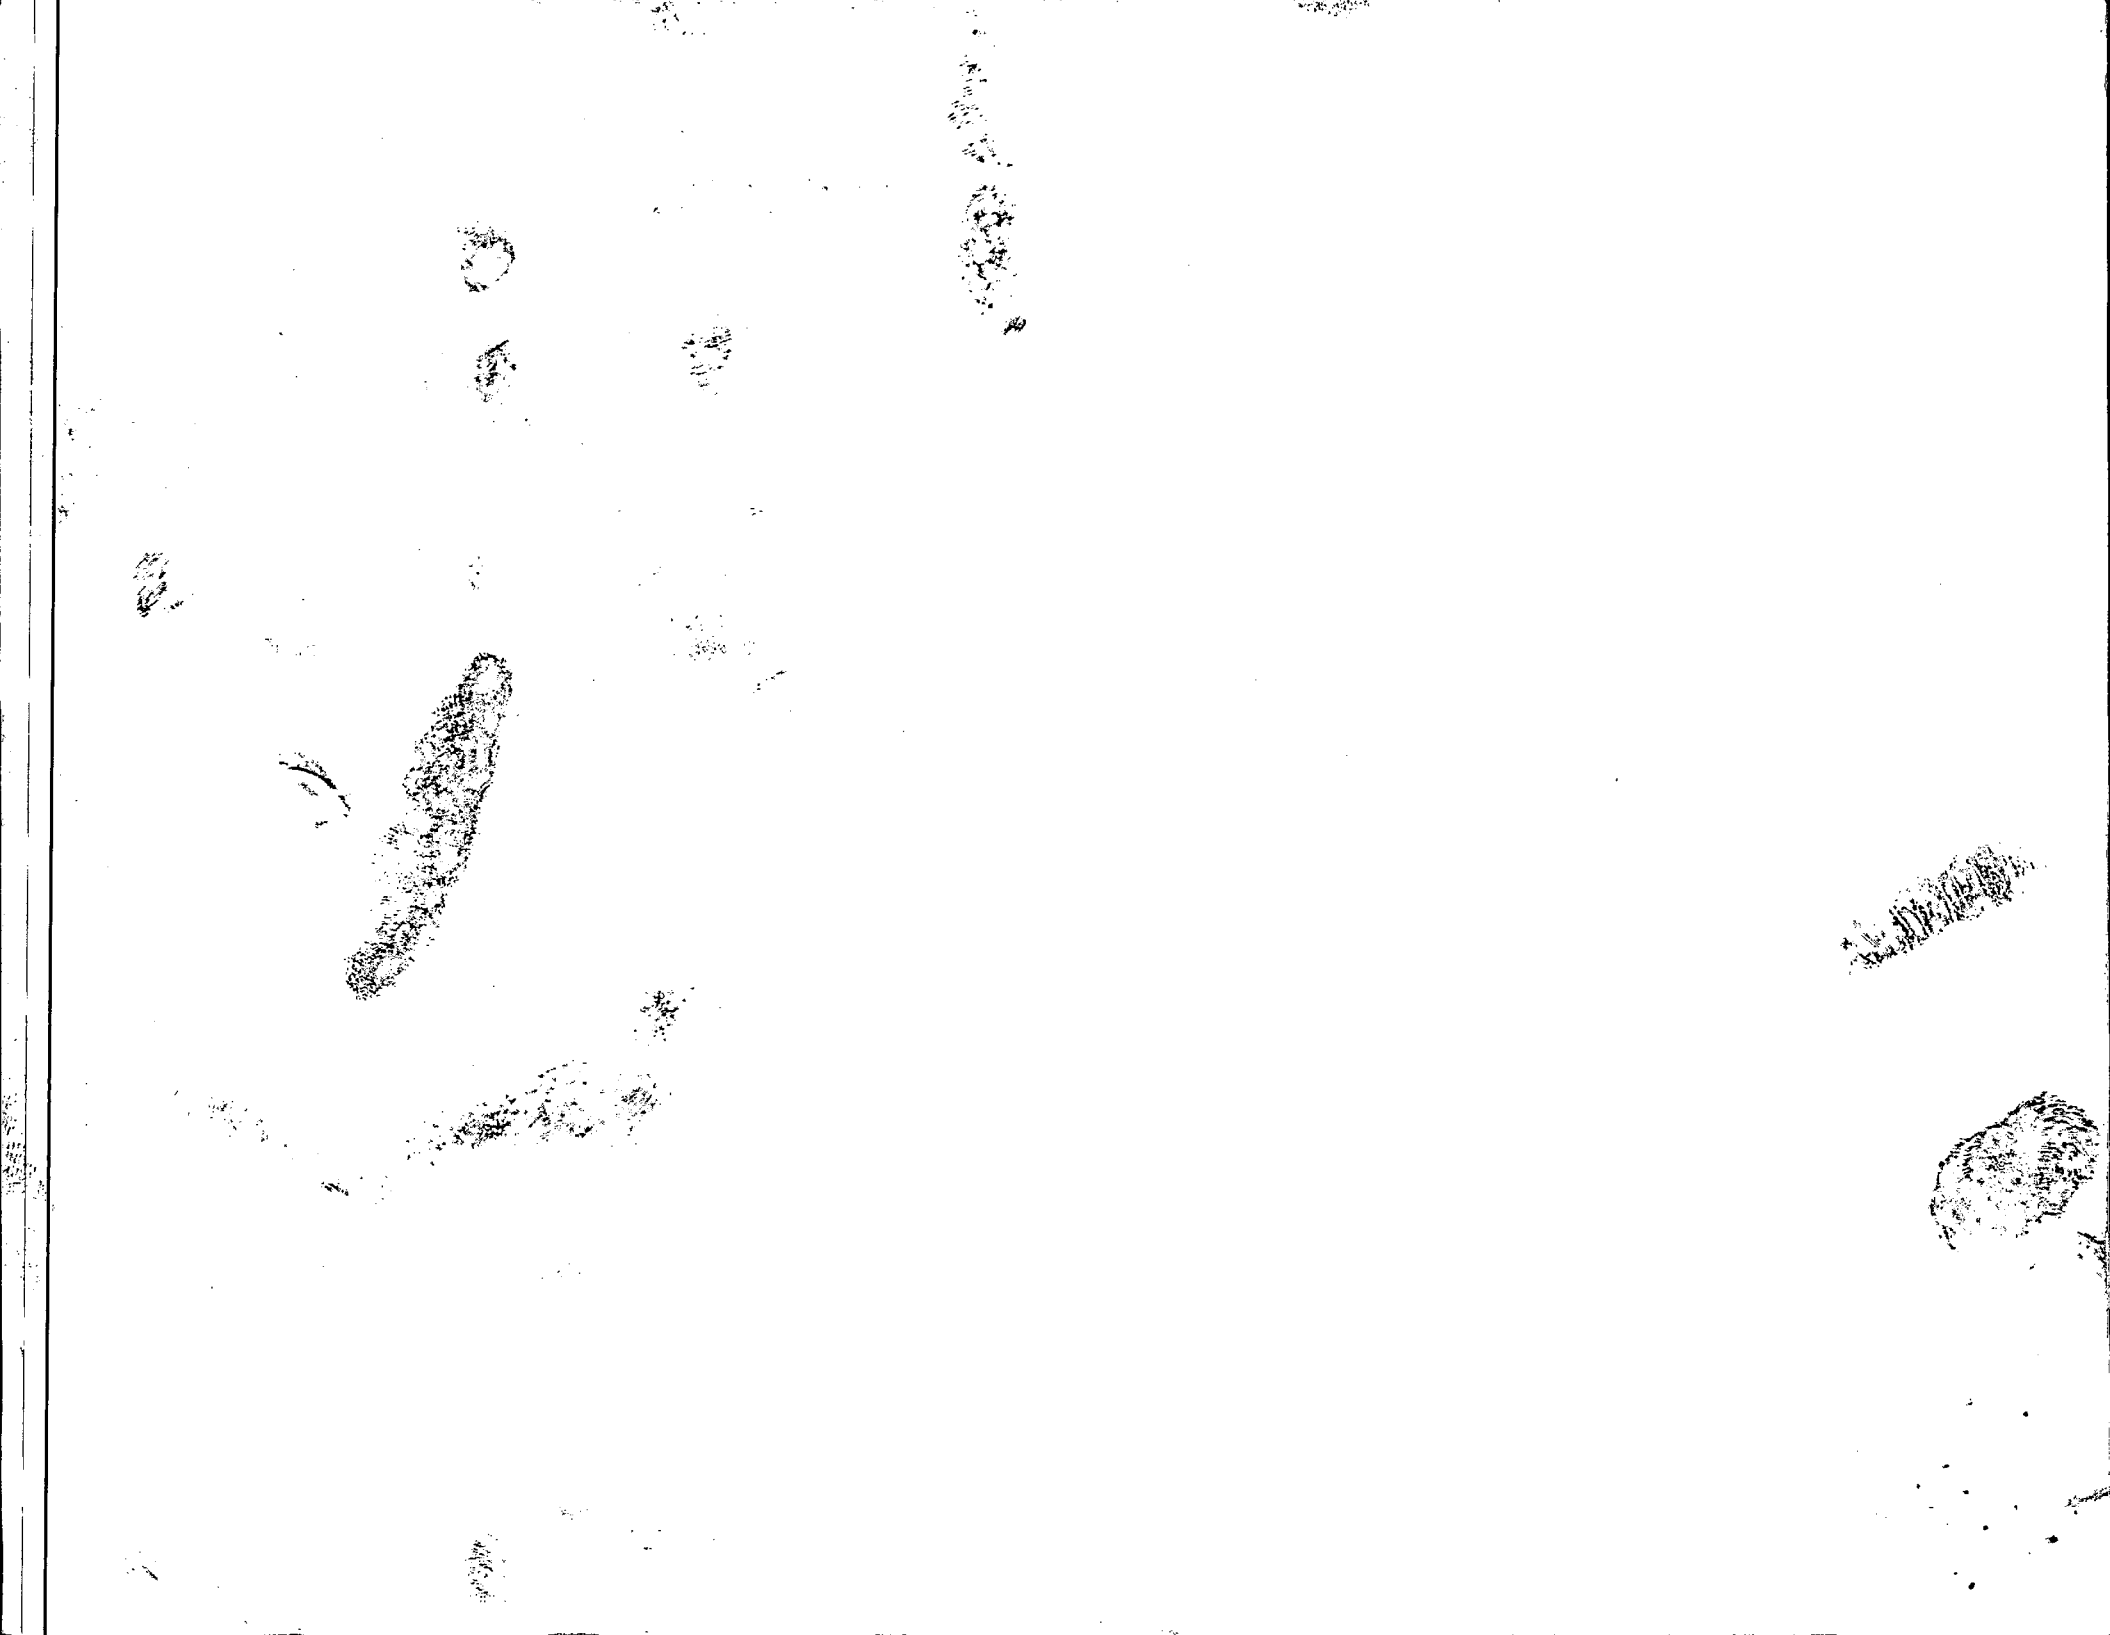


DRAWING NO.	REV.
D206-667-243	SHEET 2 OF 2
TITLE	SCALE
CROSSTUBE ASS'Y (206L HIGH AFT)	

DETAIL A: CROSSTUBE CUFF

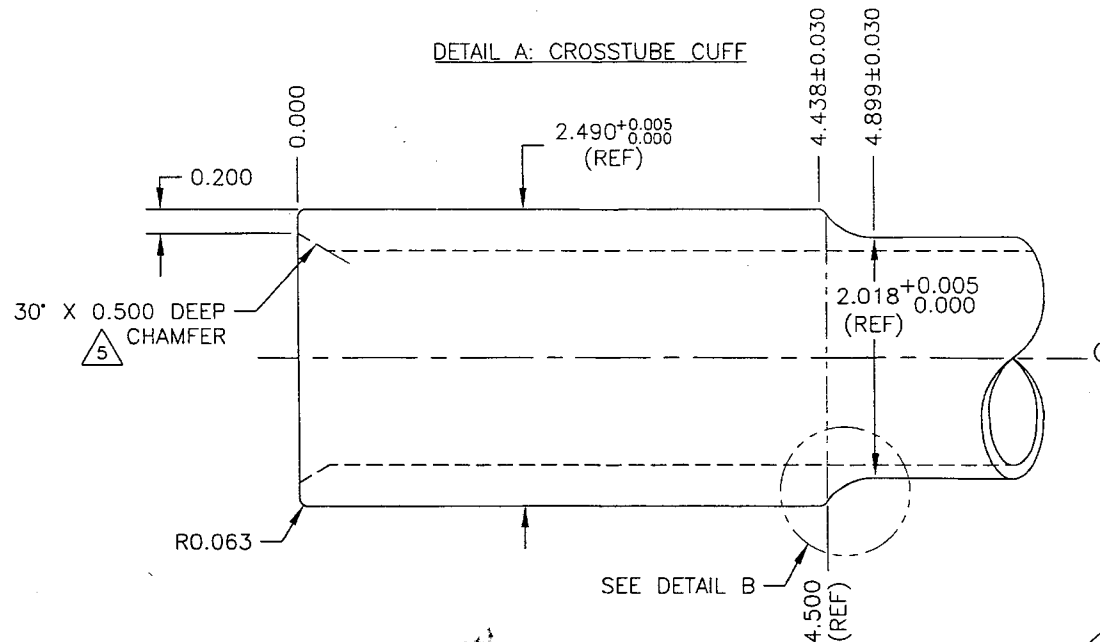


05.07.26 #
UNDER REVIEW
 06.03.26 PH
 Re-draw detail F
 PH 07.05.02

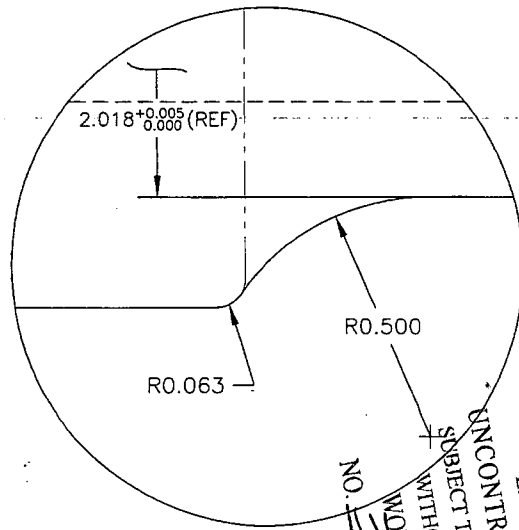

DETAIL B: CUFF
 TRANSITION
 SCALE 4:1

DETAIL C: TAPER RUN-OFF NOT TO SCALE

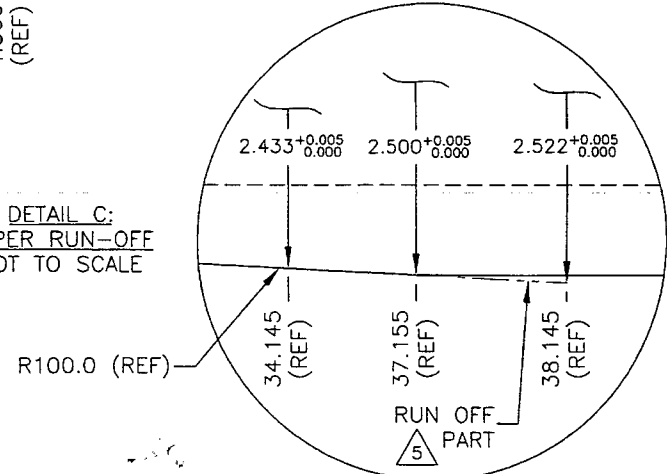

NO. 36381
 WORK ORDER
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 ENGINEERING
 RETURN TO
 SHOP COPY

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	DART DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		PH	PH	DRAWING NO. D206-667-243	REV. B SHEET 3 OF 3
CHECKED ADS		APPROVED ADS		TITLE CROSSTUBE ASS'Y (206L HIGH-AFT)	SCALE 1:1
DATE 05.07.26					





LIQUID PENETRANT TEST REPORT

P- 09828

PAGE 1 OF 1

CLIENT Dart Aerospace DATE 18 Jan 2008 TIME AM ☐ PM ☐

ATTENTION Linda Lacelle ACUREN JOB NO. 188-2-1209

ADDRESS 1270 Aberdeen st PO/NO.

Hawkesbury Ont. WORK LOCATION Hawkesbury

PROJECT 402 High AFT X-Tube assembly ACCEPTANCE STD. ASTM 1417/951-3 REV./DATE 2005

ITEM(S) EXAMINED Subs # 36383, 36384, 36385, 36386, 36379, 36381, 33541

JOB DESCRIPTION PROCEDURE NO. LT-XXXX REV./DATE TECHNIQUE NO. LT-XXXX-XXX REV./DATE

PART NO. D407667205, D206667203, D412667203 MATERIAL ALODYNE ALUMINUM THICKNESS

SCOPE WET FLOURESCENT LIQUID PENETRANT INSPECTION CARRIED OUT ON

100% OF EXTERNAL SURFACE

TEST DETAILS

METHOD ☒ FLUORESCENT ☐ VISIBLE ☐ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED

FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 8178 ☐ OUTPUT > 1000 μ W/cm² ☒ AMBIENT < 2 fc

PENETRANT ZL67 MINIMUM DWELL TIME 45 MIN. LIGHTING EQUIP. ☒ FLASHLIGHT ☐ TROUBLELIGHT ☒ OUTPUT > 100 fc @ SURFACE

PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN. OTHER

DEVELOPER SK052 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N CAL DUE DATE MAR 08

DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE

SURFACE CONDITION ☒ AS GROUND ☐ AS WELDED ☐ MACHINED ☐ SHOT BLASTED ☐ CLEAN BARE METAL

SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/ 50°F ☒ 10°C/ 50°F TO 52°C/ 125°F ☐ > 52°C/ 125°F

RESULTS- (☐ METRIC ☐ IMPERIAL)

ITEM	COMMENTS	ACCEPT	REJECT
36383	ACCEPTABLE		
36384	ACCEPTABLE		
36385	ACCEPTABLE		
36386	ACCEPTABLE		
36379	ACCEPTABLE		
36381	ACCEPTABLE		
33541	ACCEPTABLE		

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and extensions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE PRINT SIGNATURE DTR #

TECHNICIAN (SIGNATURE) Frederick Chagnon REPORT REVIEWED BY:

NAME (PRINT) Frederick Chagnon NAME INITIALS

1st TECHNICIAN CGSB LEVEL II SNT LEVEL CGSB REG. NO. 10560 2nd TECHNICIAN CGSB LEVEL SNT LEVEL CGSB REG. NO.